


## MF9015 v2

### DIMENSIONS [mm]



Weight : 650g approx.

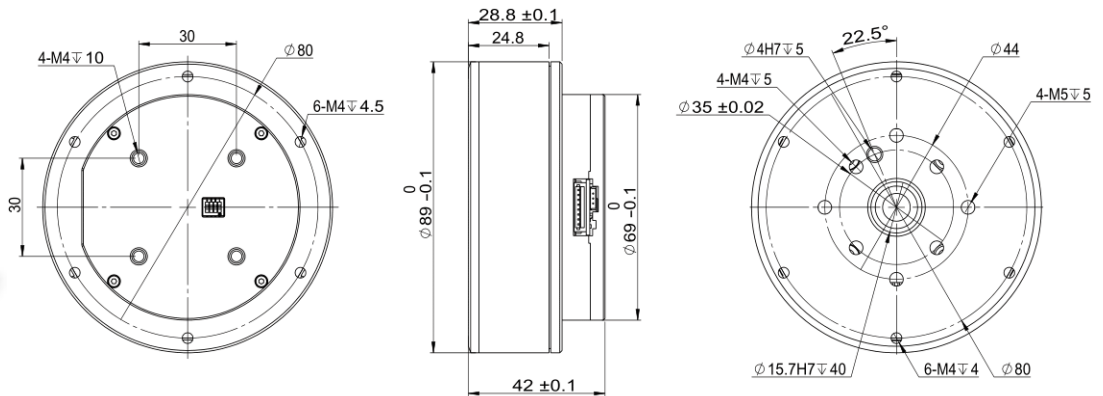

### MOTOR DATA

### Outer Rotor Brushless DC Motor

1	Nominal Voltage	VDC	24	24
2	Nominal Torque	Nm	1.63	1.67
3	Nominal Speed	rpm	640	290
4	Nominal Current	A	7.3	3.4
5	Max Speed	rpm	1070	490
6	Max Torque	Nm	5.1	5.1
7	Max Current	A	24.5	11.2
8	Max Output Power	W	120	55
9	Speed Constant	rpm/V	45	20.7
10	Torque Constant	Nm/A	0.23	0.5
11	Winding Type		Y	Y
12	Number of Winding Turns		16	35
13	Resistance (phase to phase)	Ω	0.35	1.51
14	Inductance (phase to phase)	mH	0.65	1.05
15	Number of Poles		28	
16	Rotor Inertia	gcm <sup>2</sup>	3100	
17	Working Temperature	°C	-20~+80	
18	Bearing Nominal Load	N	650	

### DRIVER DATA

### 32-bit MCU / FOC Control / Trapezoidal Acceleration

19	Input Voltage	VDC	7.4~32
20	Output Current	A	Nominal 9 / Max 15
21	Encoder		18-bit Absolute Angle-sensing Magnetic Encoder
22	Communication		RS485 or CAN
23	Communication Frequency	Hz	RS485 : 500 / CAN : 2000 (based on default baud rate)
24	RS485 Baud Rate	bps	9.6K, 19.2K, 38.4K, 57.6K, 115.2K(default), 230.4K, 460.8K, 1M, 2M
25	CAN Baud Rate	bps	125K, 250K, 500K, 1M(default)
26	Control Cycle		Torque Loop 24KHz / Speed Loop 8KHz / Position Loop 8KHz

### DRIVER INTERFACE PIN ASSIGNMENT

Pin --- B / L	RS485 - B / CAN - L
Pin --- A / H	RS485 - A / CAN - H
Pin --- V-	Power Supply - Negative
Pin --- V-	Power Supply - Negative
Pin --- V-	Power Supply - Negative
Pin --- V+	Power Supply - Positive
Pin --- V+	Power Supply - Positive
Pin --- V+	Power Supply - Positive
Pin --- T	UART Transmitter
Pin --- R	UART Receiver
Pin --- G	Signal GND

## MF9015 v2

### CHARACTERISTIC CURVE

— Input Current    — Efficiency    — Output Power    — Output Torque

